
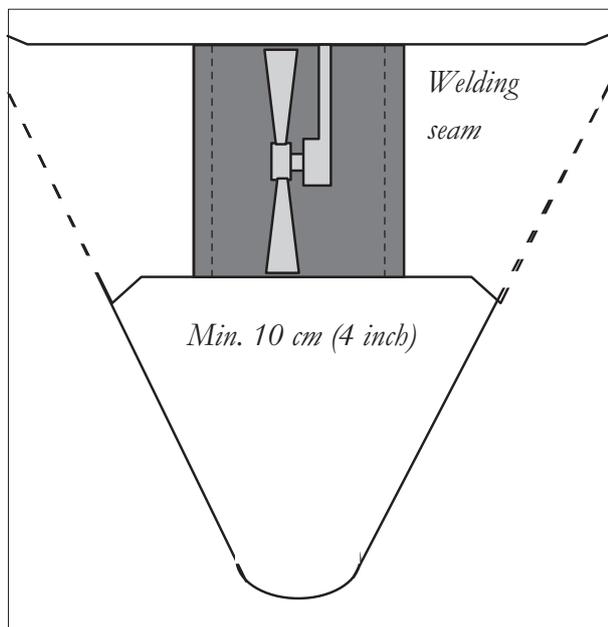


Bow Thruster tunnel - corrosion

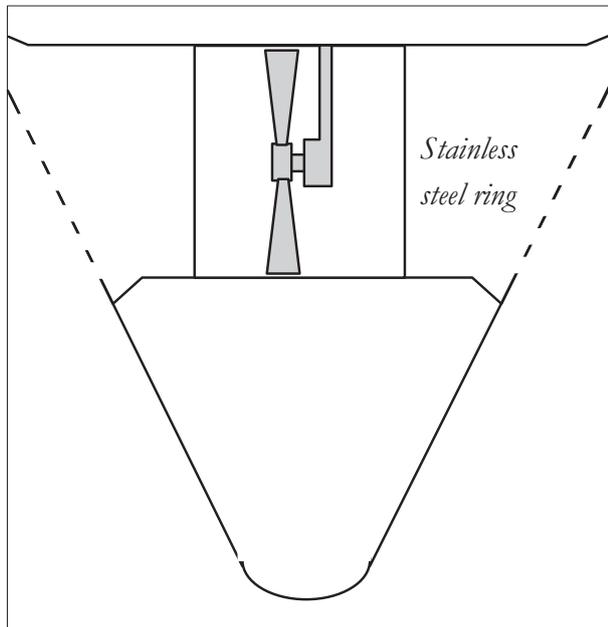

Wencon

The Bow thruster tunnel can be suffering from bi-metallic corrosion. The reason is a mix of many different metals in the area - mild steel, stainless steel ring, bronze head / propeller etc.

The area is easy to repair and to protect against bi-metallic corrosion, by rebuilding the pittings with Wencon Rapid, and coating with Wencon Coating.

1. Blast the area to SA 2,5. All the attacked areas have to be blasted - at least to 10 cm on each side of the welding seams for the stainless steel ring. Clean acc. to Wencon surface preparation, next page.
2. Coating white, while the Rapid is tacky, and let it cure.
3. Mix and apply the second layer of Wencon Coating blue, while the first layer is still tacky and let it cure.
4. The tunnel can be painted with a common ship paint here after to have an even colour.

Bow Thruster Heads can be suffering from bi-metallic corrosion. This can be repaired using the same method.

Alternative products: Wencon Ceramic products

Wencon surface preparation

Choose the relevant surface preparation, depending on the nature of the job.

Surface preparation using dry blasting methods:

Application with Wencon products on a dry surface, at minimum 3°C. above dew point.

1. Blast the machine part to SA 2,5 using sharp-edged blasting media, to a roughness of min. 75 microns.
2. Leave the part for sweating out salts in a warm place for at least 12 hours or heat it up to 30 - 40°C (86-104 °F) using gas torches.
3. Blast again to SA 2,5, prior to the application.
4. For parts containing a lot of water and salt, it may be necessary to repeat point 2 and 3, until the surface remains light grey, for at least 2 hours after blasting.
5. For optimal adhesion of Wencon products, always use Wencon Bio Cleaner or Wencon Cleaner prior to application. Follow one of below two methods:
 - 5.1 **Wencon Bio Cleaner**
Wet surface: Apply Wencon Bio Cleaner and let it work for 5-10 min. If necessary use a brush, to make sure the surface is clean. Rinse off with clean water and wipe off with an absorbing cloth. Apply Wencon UW Coating as a primer, and hereafter any Wencon products can be applied.

Dry surface: Apply Wencon Bio Cleaner and let it work for 5-10 min. If necessary use a brush, to make sure the surface is clean. Rinse off with clean water and dry with an absorbing cloth or with compressed air for a completely dry surface. Hereafter any Wencon products can be applied.
 - 5.2 **Wencon Cleaner**
After surface preparation, apply Wencon Cleaner with a brush and allow the product to evaporate before applying other Wencon products. Wencon Cleaner is non-flammable. Use only in large or well ventilated rooms.

Surface preparation using wet/damp methods:

Water jet the entire surface with water and sand to a standard, equal to SA 2,5 as described above.

If the surface is left wet after surface preparation, is it important to dry out the surface or alternatively use a Wencon UW product as a primer.

Surface preparation for emergency/temporary applications:

If above surface preparation methods are not possible, it may be necessary to use one of below methods:

- Blasting
- Grinding
- Needle Gunning

In emergency / temporary applications it may be difficult to prepare the surface according to above methods. In any case, it is important to clean the surface to SA 2,5 and 75 microns roughness. If possible dry the surface before applying. If not possible, use Wencon UW products prior to applying any other Wencon products.

For further information on Wencon surface preparation, please contact our Area Sales Managers.